

[Home](#) | [Account](#) | [Contact ALLDATA](#) | [Log Out](#) | [Help](#)**WEST FARMS WELDING**[Select Vehicle](#) | [New TSBs](#) | [Technician's Reference](#)Component Search:

Conversion Calculator

1999 Mercedes Benz Truck ML 320 (163.154) V6-3.2L (112.942)[Vehicle Level](#) → [Accessories and Optional Equipment](#) → [Technical Service Bulletins](#) → [All Technical Service Bulletins](#) → [Campaign - False Antitheft System Activation](#) ←

Campaign - False Antitheft System Activation

[Notes](#)

FILE:

SERVICE: GROUP 00 OF SERVICE INFORMATION BINDER

PARTS: GROUP I OF INFORMATION_ PARTS & ACCESSORIES BINDER

Campaign No.: 1999110002

April, 2007

Revision History

Revision	Date	Purpose
A	04/05/07	Update to parts and warranty information
-	12/01/99	Initial issue

TO: ALL MERCEDES-BENZ LIGHT TRUCK CENTERS

SUBJECT: MODEL 163

ERRONEOUS ACTIVATION OF THE ANTI-THEFT ALARM SYSTEM

Effective Serial Number Range	
Model	Up To Chassis End Number
163	A061149

Please perform this Service Campaign during the vehicles next scheduled service visit if the chassis end number falls within the Effective Serial Number Range shown. For the subject vehicles this Service Campaign must be performed "REGARDLESS OF WHETHER OR NOT THE CONDITION BELOW OCCURS"

Condition

The anti-theft alarm (ATA) may sound for no apparent reason after being armed DTC P1716, indicating an interior protection/tow sensor fault may be stored in the All Activity Module (AAM) as a result. The possible cause of this condition may be a software error in the security/trip computer tow sensor.

Procedure

1. Verify that this service campaign has not already been performed (see step 5)
2. Replace the security/trip computer depending on the vehicle options (see WIS: AR54.21-P-9832GH Removing and installing trip computer [control module](#) and AR82.20-P-1100GH, Removing and installing front overhead control panel).

3. Version code the AMM using StarDiagnosis (DAS) or the Hand-Held Tester (HHT) as follows:

^ 09 Trip computer

^ Set to "present" (if equipped)

^ 12 ATA Interior/anti-tow protection

^ Set to present

4. Read out and erase any relevant DTC's using StarDiagnosis or the HHT.

5. Affix the orange sticker supplied with the replacement computer to the inside of the garage door opener access panel or Home-link(R) universal access panel.

Note: The orange sticker is used to identify the vehicle as having been retrofitted with a new security/trip or security computer. Do not confuse the aforementioned orange sticker with the orange or green sticker that may already be present on the replacement security/trip computers.

Parts Information	
Part Name	Part Number
Security/trip computer (w/ M1 option)	A 163 540 82 11
Security/trip computer (w/o M1 option)	A 163 540 83 11

Zoom

Sized for Print

Parts Information

Warranty Information			
Operation: Control Unit for Tow-Away Protection, Replace (02-3213)			
Damage Code	Operation Number	Labor Time (hrs.)	Model Indicator(s)
82930 32 7	02-3213	0.6	K1, K2

Zoom

Sized for Print

Warranty information