 **wis**

Werkstattinformationssystem

Display Document

Sales designation:  
CLK 500

Vehicle ident. number:  
WDB209375\*

Engine number:  
113.968

Automatic transmission:  
722633

Gr.:  
68.10

Entry: Mod.Y.: Op. no.:

AR68.10-P-1507Q

Remove/install bottom section of instrument panel on front passenger's side

Full-size view

Validity OFF

Page: 2 / 6

AR68.10-P-1507Q

Remove/install bottom section of instrument panel on front passenger's side

27.9.01

MODEL 209

Shown on vehicle with COMAND  
Operating and display system, code 352

1 Glove compartment



2 Center console

3 Center console cover

4 Instrument panel bottom section on passenger side

5 Bolts

A40/3 COMAND operating, display and control unit

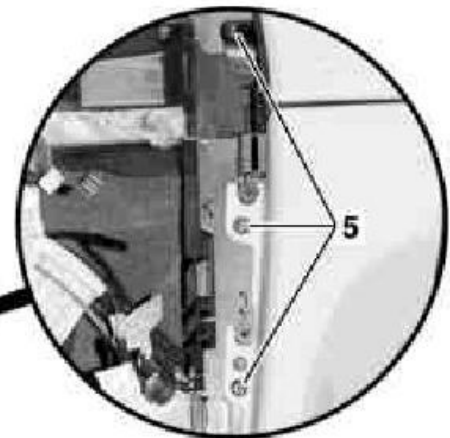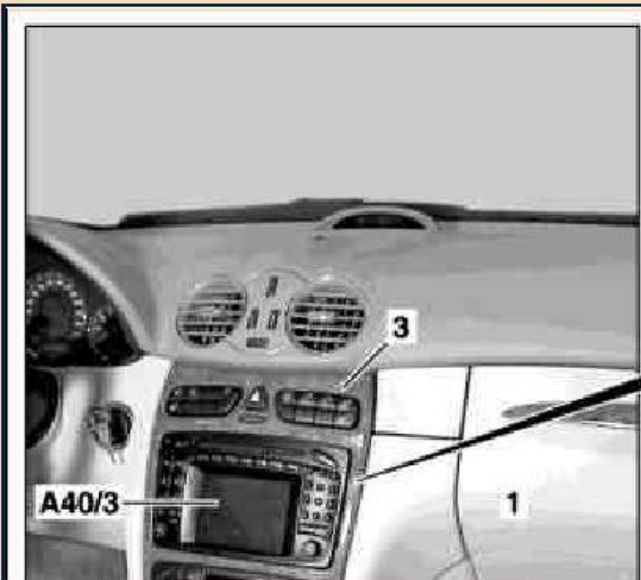

Add.  
Functions

Document  
Functions

What is  
new?


Document:  
1 / 1


Level:  
1


Menu

Help

Previous  
Screen

 **Start**

 **wis**

<< 

14:24


AR68.10-P-1507Q


Remove/install bottom section of instrument panel on front passenger's side
Normal view
Validity OFF
Page: 2 / 5


**Shown on vehicle with COMAND**  
**Operating and display system, code 352**

- 1 *Glove compartment*
- 2 *Center console*
- 3 *Center console cover*
- 4 *Instrument panel bottom section on passenger side*
- 5 *Bolts*

A40/3 *COMAND operating, display and control unit*

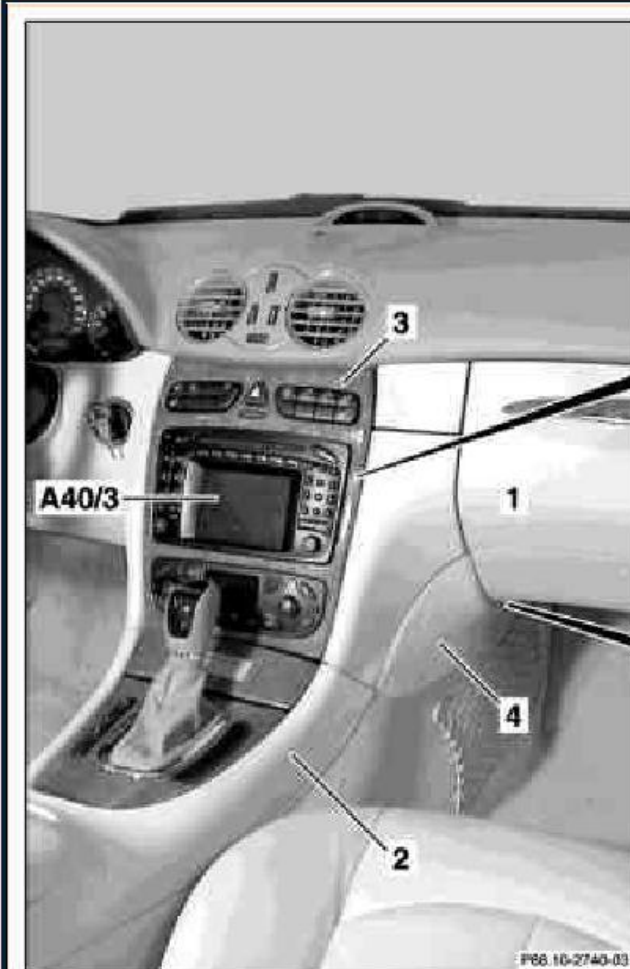

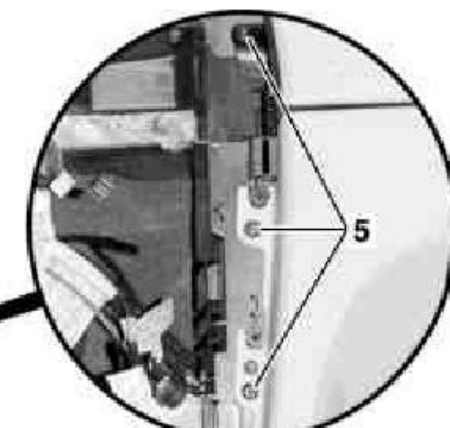

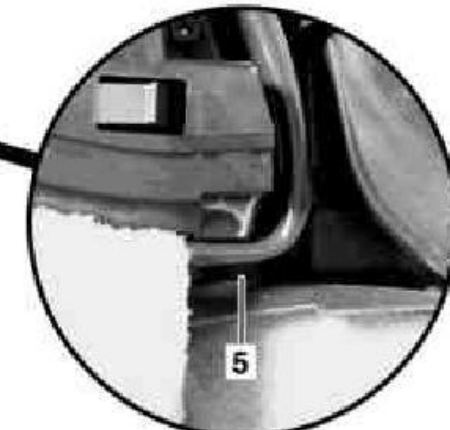


wis

<< < > >>
15:12

 **wis**

AR68.10-P-1507Q

Remove/install bottom section of instrument panel on front passenger's side

Normal view

Validity OFF


Page: 3 / 5

P68.10-2735-06

**Shown on vehicle with MB portable CTCL telephone, code 854**

7      *Antenna connection*



X39/5      *Handset transmitter and receiver connector*

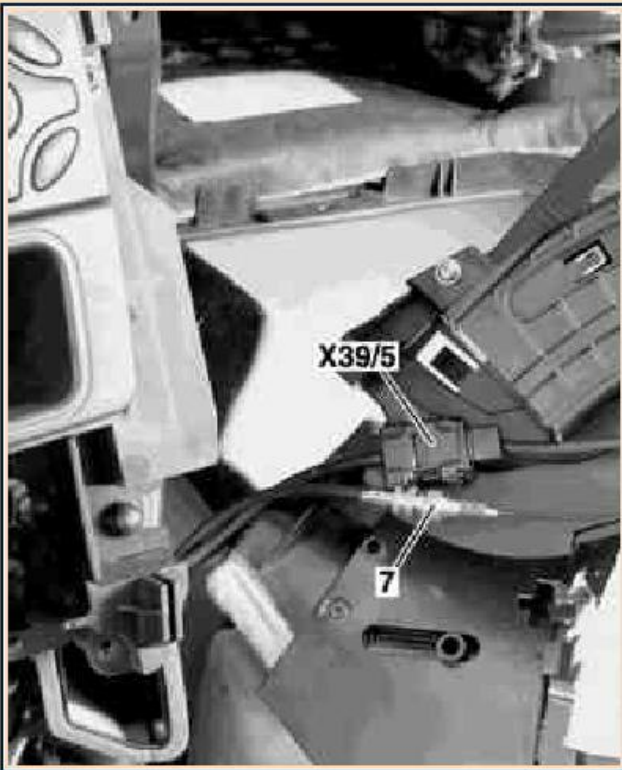


P82.70-4054-02

**Modification notes**

|         |  |  |  |
|---------|--|--|--|
| 21.1.04 | Disconnect/connect/remove ground line from battery |  |  |
|---------|--|--|--|

 **Start**  **wis**

 15:17



wis

AR68.10-P-1507Q Remove/install bottom section of instrument panel on front passenger's side Normal view Validity OFF Page: 4/ 5

|     | Remove/Install  |  |  |
|-----|---|--|--|
| 1   | Remove glove compartment (1)                              |  | AR68.10-P-1400Q                                |
| 2   | Remove center console (2)                                 |  | AR68.20-P-2000Q                                |
| 3   | Remove center console cover (3)                           |  | AR68.20-P-2350Q                                |
| 4.1 | Loosen COMAND operating, display and control unit (A40/3) | <p>up to 31.5.04<br/>with COMAND operating and display system, code 352, with Japanese version, code 498<br/>as of 1.6.04<br/>with Japanese version, code 498, with COMAND APS (with navigation) code 527, with COMAND APS USA (with navigation) code 530</p> <p><b>i</b> Position COMAND operating, display and control unit (A40/3) so that bolts on passenger-side instrument panel bottom section are accessible</p> <p><b>i</b> Do not unplug connectors.</p> | <p>AR82.85-P-7472Q</p> <p>AR82.85-P-7472QA</p> |
| 4.2 | Detach radio  | <p>up to 31.5.04 ,<br/>up to 31.5.04 with MB Audio radio 10 CD with VK/RDS, code 756<br/>as of 1.6.04</p>  | <p>AR82.60-P-7502Q</p> <p>AR82.60-P-7502QA</p> |

Start wis

<< 15:20

**wis** AR68.10-P-1507Q Remove/install bottom section of instrument panel on front passenger's side Normal view Validity OFF Page: 5/ 5

|     |  |  |   |
|-----|--|--|---|
|     |  | <p><b>i</b> Do not unplug connectors.</p>  |   |
| 4.2 | Detach radio   | <p>up to 31.5.04 ,</p> <p>up to 31.5.04 with MB Audio radio 10 CD with VK/RDS, code 756</p> <p>as of 1.6.04</p> <p>up to 31.5.04 with Audio 30 APS, code 353</p> <p>As of 1.6.04 with Audio 50 APS MB radio, code 525</p> <p><b>i</b> Position radio so that bolts for passenger-side instrument panel bottom section are accessible</p> <p><b>i</b> Do not unplug connectors.</p> | <p>AR82.60-P-7502Q</p> <p>AR82.60-P-7502QA</p> <p>AR82.61-P-7412P</p> <p>AR82.61-P-7412QA</p> |
| 5   | Unscrew bolts (5)  |  |   |
| 6   | Remove instrument panel bottom section on passenger side (4)                         |  |   |
| 7.1 | Detach handset transmitter and receiver connector (X39/5) and antenna connection (7) | On vehicles with MB portable CTCL telephone, code 854  |   |
| 8   | Install in the reverse order   |  |   |

**Start** **wis** << 15:22