


A. As of approx. 09/84 to approx. 08/85

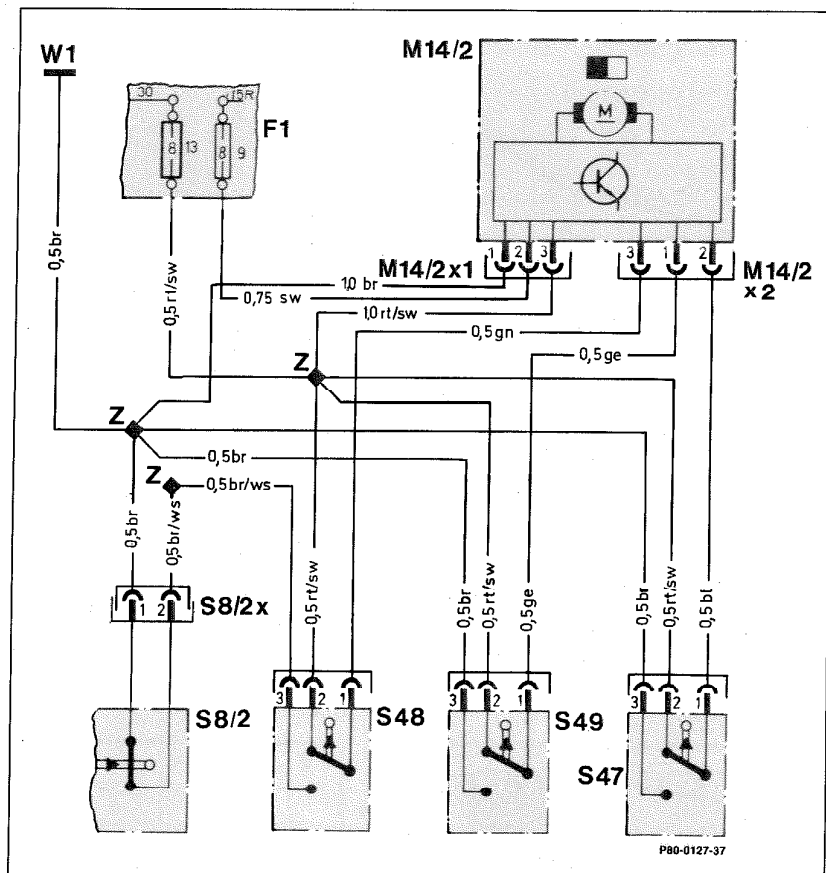


P80-0127-37

| | | | |
|---------|---|-----|--|
| F1 | Fuse and relay box | S47 | Left front door actuator |
| M14/2 | Supply pump (CL/OSB) | S48 | Right front door actuator |
| M14/2x1 | Supply pump voltage supply connector (CL/OSB) | S49 | Trunk lid lock actuator |
| M14/2x2 | Supply pump control line connector (CL/OSB) | W1 | Main ground (behind instrument cluster) |
| S8/2 | Warning buzzer contact (exterior lamps/CL) | Z | Connector sleeve (solder joint in harness) |
| S8/2x | Connector, warning buzzer contact lighting/central locking system | | |

Note

Black cable from M14/2x1 jack 2 to F1, fuse 9 is only installed with orthopedic backrest.

B. As of approx. 09/85 to approx. 04/86

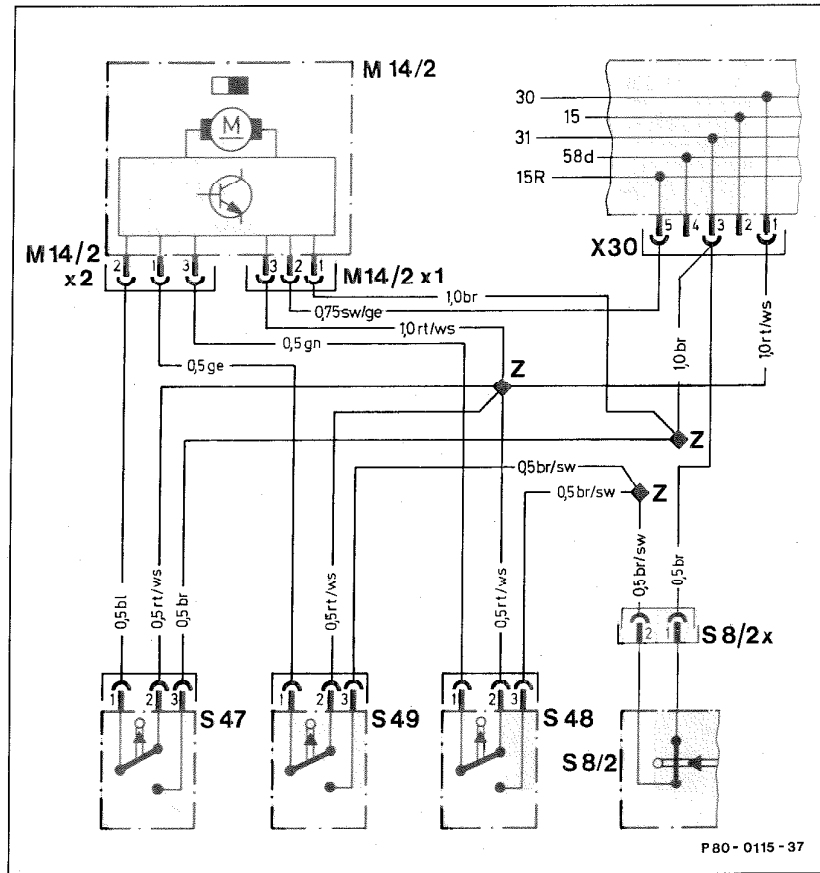

P80-0115-37

P80-0115-37

| | | | |
|---------|--|-----|--|
| M14/2 | Supply pump (CL/OSB) | S47 | Left front door actuator |
| M14/2x1 | Supply pump voltage supply connector (CL/OSB) | S48 | Right front door actuator |
| M14/2x2 | Supply pump control line connector (CL/OSB) | S49 | Trunk lid lock actuator |
| S8/2 | Warning buzzer contact (exterior lamps/CL) | X30 | Accessory equipment connector block |
| S8/2x | Connector, warning buzzer contact lighting/central locking system | Z | Connector sleeve (solder joint in harness) |

Note

Black/yellow cable from M14/2x1 jack 2 to X30
jack 5 is only installed with orthopedic backrest.



P80-0129-37

| | | | |
|---------|--|-----|--|
| F1 | Fuse and relay box | S47 | Left front door actuator |
| M14/2 | Supply pump (CL/OSB) | S48 | Right front door actuator |
| M14/2x1 | Supply pump voltage supply connector (CL/OSB) | S49 | Trunk lid lock actuator |
| M14/2x2 | Supply pump control line connector (CL/OSB) | W1 | Main ground (behind instrument cluster) |
| S8/2 | Warning buzzer contact (exterior lamps/CL) | X30 | Accessory equipment connector block |
| S8/2x | Connector, warning buzzer contact lighting/central locking system | Z | Connector sleeve (solder joint in harness) |

Note

Black/yellow cable from M14/2x1 jack 2 to X30 jack 5 is only installed with orthopedic backrest.